

P2240: O2 SENSOR POSITIVE CURRENT CONTROL CIRCUIT/OPEN BANK 2 SENSOR 1

OVERVIEW

Severity	:	Medium
DIY Difficulty Level	:	Intermediate
Repair Cost	:	\$100-\$300
Can I Still Drive?	:	Yes

What Does The P2240 Code Mean?

A stored code P2240 means that the powertrain control module (PCM) has detected a positive current discrepancy in the upstream oxygen (O2) sensor for engine bank number two. Bank two is the engine bank that doesn't contain the number one cylinder. Sensor 1 denotes the upstream (pre-cat) sensor. The positive current control circuit is a low voltage circuit.

In order to monitor the exhaust oxygen content for each engine bank, as well as catalytic converter efficiency, the PCM uses data input from heated oxygen sensors (HO2S).

Oxygen sensors are constructed using a zirconium dioxide sensing element situated in the center of a vented steel housing. Small platinum electrodes are soldered between the sensing element and wire leads in the oxygen sensor harness connector.

The O2 sensor harness connector plugs into the controller area network (CAN) which attaches the HO2S wiring harness to the PCM connector.

Each HO2S is threaded (or studded) into an exhaust pipe or manifold. It is positioned so that the sensing element is near the center of the pipe. Spent exhaust gases exit the combustion chamber (via the exhaust manifold) and continue through the exhaust system (including catalytic converters); flowing over the oxygen sensors.

Exhaust gases flow into the oxygen sensor through specially designed vent holes in the steel housing and swirl around the sensing element. Drawn through wire lead cavities in the sensor housing, the air fills a tiny chamber in the middle of the sensor. The heated air (in the tiny chamber) forces the oxygen ions to produce energy that is recognized by the PCM as voltage.


Variations between the number of O₂ ions in ambient air, and the number of oxygen molecules in the exhaust, cause the heated oxygen ions inside the HO₂S to bounce from one platinum layer to the other, very swiftly and repetitively.

As the surging oxygen ions shift between platinum layers, variations in HO₂S output voltage occur. The PCM sees these variations in HO₂S output voltage as changes in exhaust oxygen concentration.

Voltage signal outputs from the HO₂S are lower when more oxygen is present in the exhaust (lean condition) and higher when less oxygen is present in the exhaust (rich condition). This portion of the HO₂S uses low voltage (less than one-volt).

In a separate section of the sensor, the HO₂S is preheated using battery voltage (12-volts). When engine temperature is low, battery voltage heats up the HO₂S so that it can begin to monitor exhaust oxygen content faster.

If the PCM detects a degree of voltage that is not commiserate with acceptable parameters, a P2240 will be stored and a malfunction indicator lamp (MIL) may be illuminated. Most vehicles will require multiple ignition cycles (with a failure) for MIL illumination.

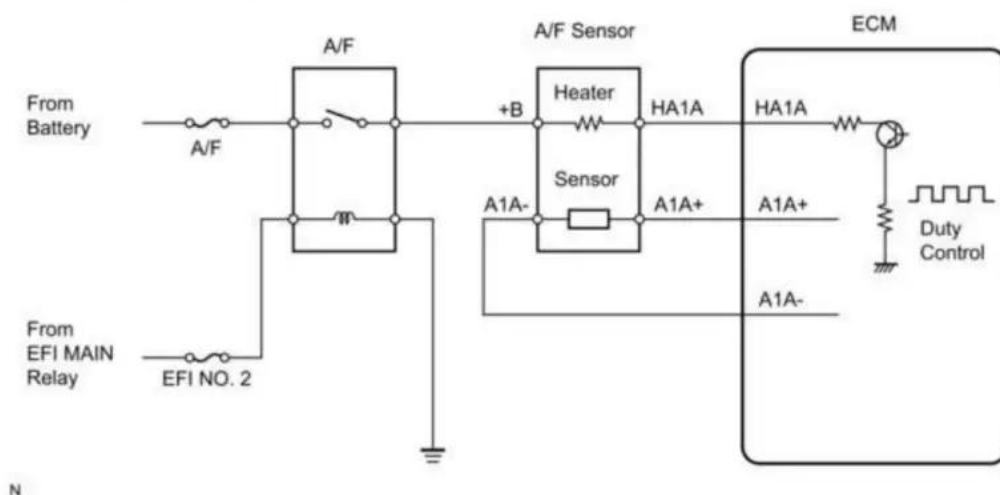

P2240 wiring diagram

What Are The Symptoms Of The P2240 Code?

Symptoms of a P2240 trouble code may include:

- Reduction in fuel efficiency
- Diminished engine performance
- Stored misfire codes or lean/rich exhaust codes
- Service engine soon lamp illumination

What Are The Potential Causes Of The P2240 Code?

Causes for this code may include:

- Defective oxygen sensor/s
- Burnt, chafed, broken, or disconnected wiring and/or connectors
- Faulty PCM or PCM programming error

How Can You Fix The P2240 Code?

A diagnostic scanner, a digital volt/ohmmeter (DVOM), and a source of reliable vehicle information will be needed in order to accurately diagnose a code P2240.

Step 1

Connect the scanner to the vehicle diagnostic port and retrieve all stored codes and pertinent freeze frame data. You will want to write this information down just in case the code proves to be an intermittent one. Next, clear the codes and test drive the vehicle. One of two things will occur at this time. Either the code P2240 will be reset or the PCM will enter readiness mode.

Step 2

If the code is intermittent and the PCM enters readiness mode, it may prove to be more difficult to diagnose. Conditions which caused the P2240 to be stored may need to worsen before an accurate diagnosis can be made. If the code is reset, continue with your diagnosis.

Step 3

Connector face views, connector pinout charts, component locator charts, wiring diagrams, and diagnostic flow charts (pertaining to the code and vehicle in question) can be found by using your source of vehicle information.

Perform a visual inspection of HO2S related wiring and connectors. Replace wiring that has been cut, burned, or damaged.

Step 4

Unplug the HO2S in question and use the DVOM to check resistance between the positive current control circuit and any ground circuits. If there is continuity, suspect a defective HO2S.

Step 5

If the code P2240 continues to be reset, start the engine. Allow it to reach normal operating temperature and idle (with the transmission in neutral or park). Connect the scanner to the vehicle diagnostic port and observe oxygen sensor input data on the data stream. Narrow the scope of the data stream to include only pertinent data and you will get a faster response.

Step 6

If the oxygen sensors are functioning normally, voltage on pre-cat oxygen sensors will cycle continuously between 1 and 900-millivolts once the PCM enters closed loop operation.

Post-cat sensors will cycle between 1 and 900-millivolts as well but they will settle at a certain point and remain relatively stable (compared to the pre-cat sensors). HO2S which fail to cycle adequately should be considered defective if the engine is in good working order.

Step 7

If the HO2S displays battery voltage or no voltage on the scanner data stream, use the DVOM to obtain live data from the HO2S connector. If the output data remains the same, suspect an internal HO2S short that will require replacement of the HO2S.

Additional note:

- In most cases, you will rectify this type of code by replacing the HO2S in question but complete your diagnosis anyway

Severity Description

An HO2S with a control circuit problem could result in a very poor running engine and various drivability issues. A code P2240 should be classified as severe and rectified as quickly as possible.

Reference Sources

[P2240 O2 Sensor Positive Current Control Circuit/Open Bank 2 Sensor 1](#), OBD-Codes.